



Set Configuration: Metric

Full set

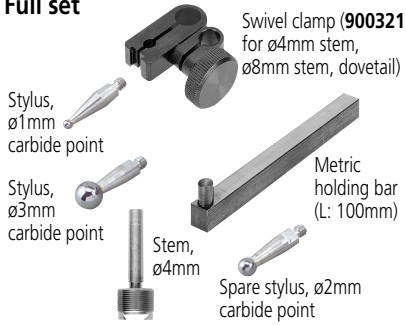


Basic set

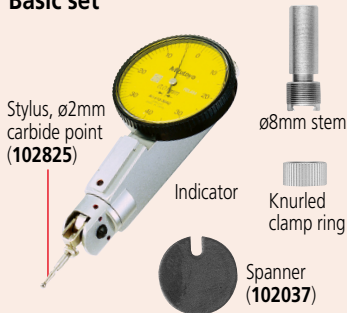


Set Configuration: Inch

Full set

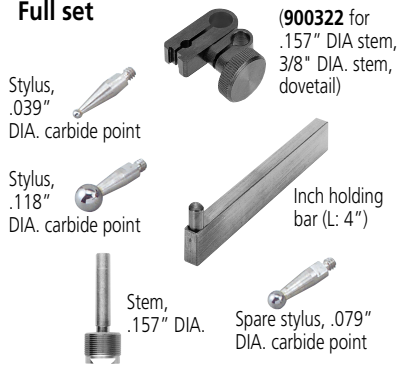

Basic set

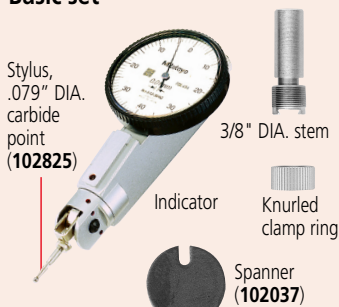


Optional Accessories

- : Swivel clamps (See page F-63.)
- : Holding bars (See page F-63.)
- : Stems (See page F-63.)
- 102824:** Stylus, ø1mm ball contact (carbide)
- 102825:** Stylus, ø2mm ball contact (carbide)
- 102826:** Stylus, ø3mm ball contact (carbide)

Dial Test Indicator SERIES 513 — Universal Type

- Universal application to all directions. (Not only the direction of the measuring point, but also the direction of measurement itself can be adjusted 360 degrees without moving the indicator.)

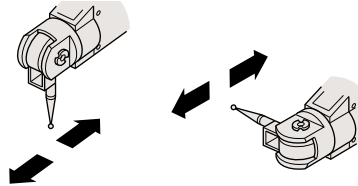


513-304GE

SPECIFICATIONS

Metric		Graduation	Range	Accuracy	Dial reading	Measuring force	Jeweled bearing				
Order No.	Order No.										
Basic set	Full set										
513-304GE	513-304GT	0.01mm	0.8mm	8µm	0-40-0	0.3N or less	✓	—	—	—	—

Inch		Graduation	Range	Accuracy	Dial reading	Measuring force	Jeweled bearing				
Order No.	Order No.										
Basic set	Full set										
513-302G	513-302GT	.0005"	.03"	±.0005"	0-15-0	0.3N or less	✓	—	—	—	—

DIMENSIONS

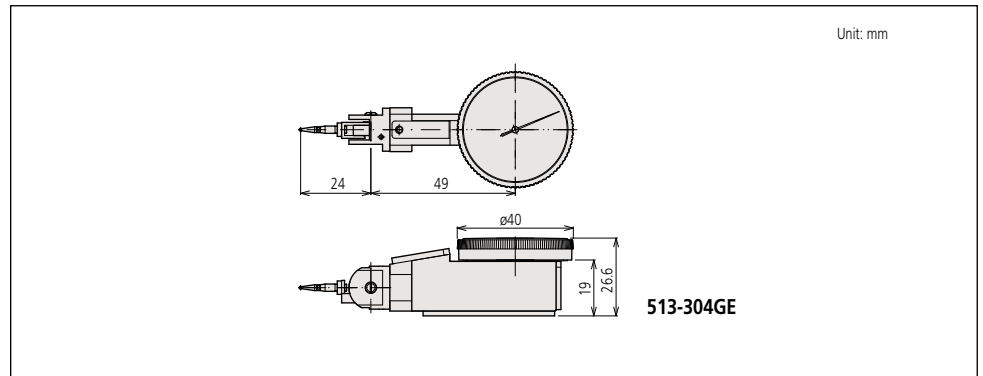

513-304GE